



## JACKPOT MUNICIPAL AIRPORT

### Pavement Condition


The average projected Pavement Condition Index (PCI) for all of the airfield pavements was **88**. The runway had an average projected PCI of **84** and was above the desired minimum service level (MSL) of **60**.

### Maintenance Needs

PCI analysis identified approximately **\$17,000** in pavement maintenance needs, such as patching and crack sealing, that could be completed immediately.

### Capital Needs


No pavement features were below the MSL when inspected, and no features are projected to reach the MSL in the next 5 years. The following graph shows that the PCI is projected to fall from **88** to **80** by **2014**.

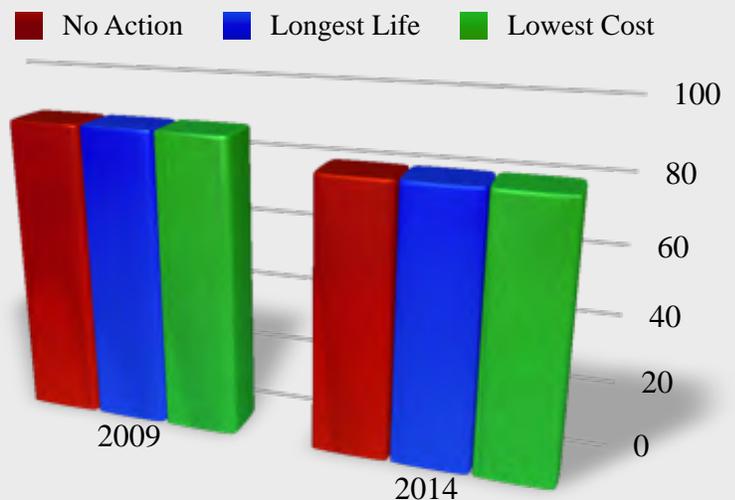

JACKPOT AIRPORT  
2008 PCI Inspection

PCI LEGEND

100-86	Excellent	
85-71	Very Good	
70-56	Good	
55-41	Fair	
40-26	Poor	
25-11	Very Poor	
10-0	Failed	

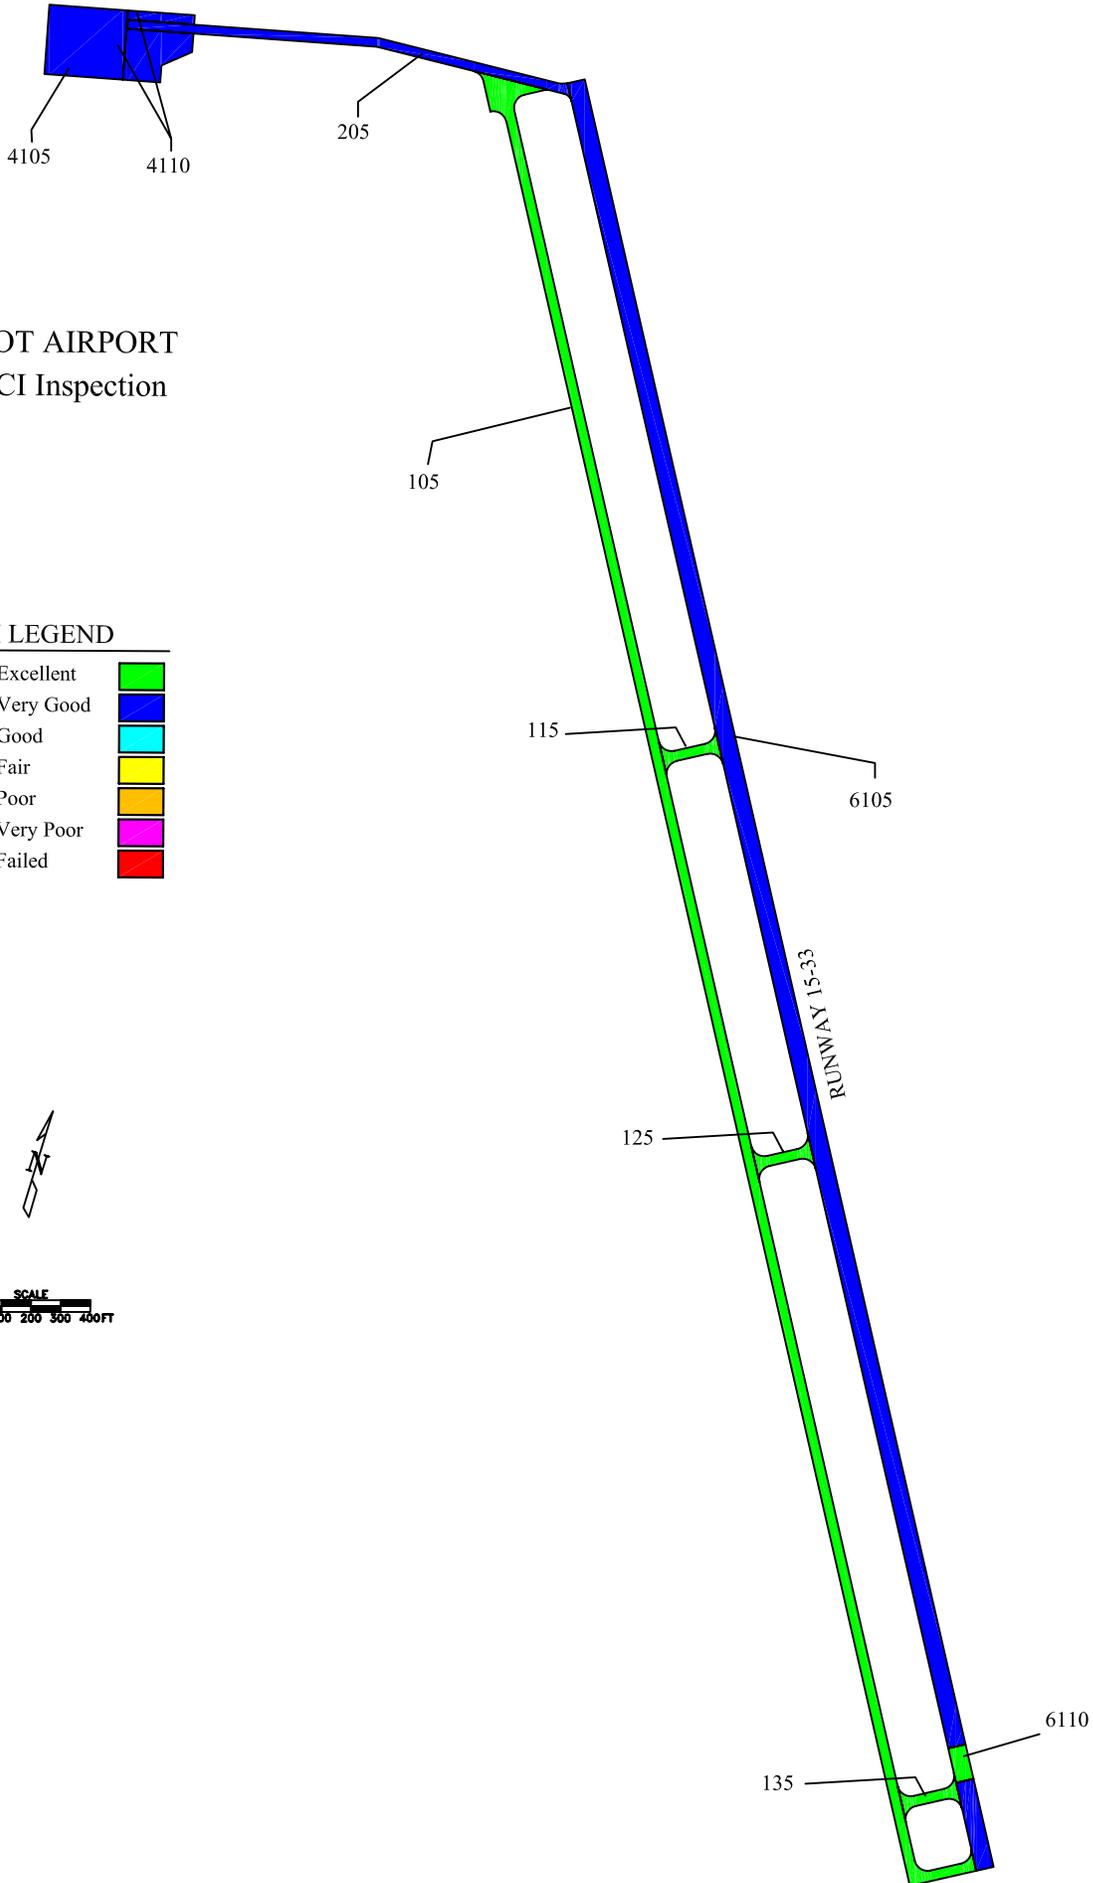

# PCI HISTORY

FEATURE	PCI	TYPE	AGE	DET. RATE
105	95	AC	1	5
115	100	AC	0	N/A
125	100	AC	0	N/A
135	100	AC	0	N/A
205	84	AC/AC	8	2
4105	79	AC/AC	11	1.9
4110	85	AC/AC	9	1.7
6105	84	AC/AC	11	1.5
6110	100	AC	0	N/A

# VIABLE CIP ACTIONS

FEATURE	ACTION YR	ACTION	COST (\$)	LIFE EXT
105	2020	Resurfacing	332,799	17